

Nº Cil Ø

Junta culata

PVR

Referencia

PVR

Tornillos

BMW Gasolina

<p>116 N40 B16A 1596 84 115 04> Inyección N45 B16 4 16 Válvulas N45 B16A</p> <p style="text-align: right;">1</p>	<p>61-36255-00 60,15 Ø 84,5mm 0,4mm - MLS</p> <p>61-36255-10 60,15 Ø 84,5mm 0,7mm - MLS +0,30mm</p> <p>61-37625-00 123,24 Ø 85mm 0,5mm - MLS</p> <p>61-37625-10 165,54 Ø 85mm 0,8mm - MLS +0,30mm</p>	<p>PA 02-37283-01 240,75 sin junta culata</p>	<p>HBS467 (3) M8 x 1.25 x 95 (3) M8 x 1.25 x 125 (6) M10 x 1.50 x 170</p>
<p>316 M40 B16 1596 84 102 87> E30 / E36 164E1 4 93> Distribución por Correa Inyección</p> <p style="text-align: right;">2</p>	<p>30-026068-20 BR831 41,05 Ø 85mm - Fibra</p> <p>30-026069-20 97,80 Ø 85mm + 0,30mm - Fibra</p>	<p>PA 21-26068-21/0 DR830 144,80 Junta Colector Admisión</p>	<p>HBS069 (10) M10 x 1.50 x 95</p>
<p>316 M40 B16 1596 84 102 87> E36 164E1 4 93> Inyección</p> <p style="text-align: right;">3</p>	<p>30-026068-20 BR831 41,05 Ø 85mm - Fibra</p> <p>30-026069-20 97,80 Ø 85mm + 0,30mm - Fibra</p>	<p>PA 21-26068-24/0 202,51 Junta Colector Admisión</p>	<p>HBS069 (10) M10 x 1.50 x 95</p>
<p>316 M43 B16 1596 84 105 98> E46 164E3 4 Inyección</p> <p style="text-align: right;">4</p>	<p>30-026068-20 BR831 41,05 Ø 85mm - Fibra</p>	<p>PA 21-26068-23/0 185,09 Junta Colector Admisión Goma</p> <p>BI 71-3419/4 STD 47,12</p>	<p>HBS069 (10) M10 x 1.50 x 95</p>

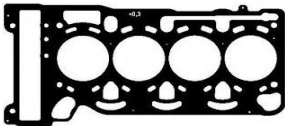

				
Nº Cil	Ø	Junta culata	PVR	Referencia
				PVR
				Tornillos



BMW Gasolina

318 518 <i>Inyección</i>	M40 B18 M42 B18ME 184E1	1795 84 4 >91	115 87>	5	30-026068-20 BR831 Ø 85mm - Fibra 30-026069-20 Ø 85mm + 0,30mm - Fibra	41,05 97,80	PA 21-26068-21/0 DR830 Junta Colector Admisión BI 71-3419/4 STD	144,80 47,12	HBS069 (10) M10 x 1.50 x 95
318 518 E36 <i>Inyección</i>	M40 B18 184E2	1796 84 4 >95	113 87>	6	30-026068-20 BR831 Ø 85mm - Fibra 30-026069-20 Ø 85mm + 0,30mm - Fibra	41,05 97,80	PA 21-26068-24/0 Junta Colector Admisión	202,51	HBS069 (10) M10 x 1.50 x 95
316 16 Válvulas	N42 B18 N46 B18 N46 B18A	1796 84 4	115 02>	7	61-36255-00 Ø 84,5mm 0,4mm - MLS 61-36255-10 Ø 84,5mm 0,7mm - MLS +0,30mm	60,15 60,15	PA 02-37293-01 sin junta culata	278,89	HBS467 (3) M8 x 1.25 x 95 (3) M8 x 1.25 x 125 (6) M10 x 1.50 x 170
318 Z3 <i>Inyección</i>	M43 B19 194E1	1895 85 4 >01	118 98>	8	30-028501-10 Ø 86mm - Fibra	37,05	PA 21-28501-20/0 BI 71-3419/4 STD BA H007/5 DIAM 85 1,2X1,5X2	201,33 47,12	HBS069 (10) M10 x 1.50 x 95
318 Z3 E36 / is / ti <i>Inyección 16 Válvulas</i>	M44 B19 194S1	1895 85 4 >00	140 95>	9	30-027702-10 BZ131 Ø 86mm - Fibra	39,91	PA 21-27702-21/0 BI 71-3419/4 STD	224,50 47,12	HBS069 (10) M10 x 1.50 x 95

					
	Nº Cil Ø	Junta culata	PVR	Referencia	PVR

BMW Gasolina

<p>320 S14 1990 93,4 192 88> IS 204SA 4 16 Válvulas 204EA</p>	<p>30-026447-10 Ø 94,5mm</p>	<p>PA 21-26447-20/0</p>	<p>256,11</p>	
<p>320 M52 B20 1991 80 150 94> 520 206S3 6 >98 E39 Vanos Inyección 24 Válvulas</p>	<p>30-026705-20 BT681 73,76 Ø 81mm 1,5mm Fibra 30-026818-20 Ø 81mm 1,8mm</p>	<p>PA 21-26705-22/0 199,28 09 / 1994 > 09 / 1995 PA 21-26705-23/0 192,33 10 / 1995 > 09 / 1998 Junta Tapa Válvulas Goma BI 71-3419/4 STD 47,12</p>		<p>HBS068 x 95 HBS067</p>
<p>320 M52 1991 80 150 98> 520 206S4 6 Z3 E46 Inyección 24 Válvulas</p>	<p>30-029078-00 106,70 Ø 81mm Multiálaminas</p>	<p>PA 21-29078-20/0 330,41 BI 71-3419/6 STD 70,72</p>		<p>HBS068 (14) M10 x 1.50 x 95 Para Bloque de Hierro HBS067 (14) M10 x 1.50 x 110 Para Bloque de</p>
<p>318 N42 B20 1995 84 143 01> 320 N43 B20A 4 ti / ci / is N46 B20 Inyección N46 B20A 16 Válvulas N46 B20B N46 B20C</p> 	<p>61-36255-00 --> 01/07 60,15 Ø 84,5mm - 0,4mm Multiálaminas 61-37625-00 02/07 --> 123,24 Ø 85mm - 0,5mm Multiálaminas</p>	<p>PA 02-37293-01 278,89 Sin Junta de Culata BI 71-4806/4 STD 59,65</p> 		<p>HBS467 (3) M8 x 1.25 x 95 (3) M8 x 1.25 x 125 (6) M10 x 1.50 x 170</p>

							
Nº Cil Ø			Junta culata	PVR	Referencia	PVR	Tornillos
BMW Gasolina							
320 520 Z3 E46 Inyección 24 Válvulas	M54 226S1	2171 80 170 00> 6	30-029078-00 Ø 81mm Multiáminas	106,70	PA 21-29078-21/0 Sin Junta de Culata > 09>2002 PA 21-29100-21/0 Incluye Junta de Culata Con Junta Colector de Pantalla 10/2002>	319,69 416,45	HBS068 (14) M10 x 1.50 x 95 Para Bloque de Hierro HBS067 (14) M10 x 1.50 x 110 Para Bloque de Aluminio
M3 IS 16 Válvulas	S14 234S1	2302 93,4 215 86> 4	30-026447-10 Ø 94,5mm		PA 21-26447-20/0	256,11	
325 525 Z4 E46 / E39 Inyección 24 Válvulas	M54 B25 256S5	2494 80 192 00> 6	30-029100-00 Ø 85mm 0,7 mm - MLS 30-030053-00 Ø 85mm 1,00 mm MLS + 0,30mm	102,81 205,97	PA 21-29078-21/0 Sin Junta de Culata > 09>2002 PA 21-29100-21/0 Incluye Junta de Culata Con Junta Colector de Pantalla 10/2002> BI 71-3419/6 STD	319,69 416,45 70,72	HBS068 (14) M10 x 1.50 x 95 Para Bloque de Hierro HBS067 (14) M10 x 1.50 x 110 Para Bloque de Aluminio

				Junta culata	PVR	Referencia	PVR	Tornillos
Nº Cil Ø								
BMW Gasolina								
325	M50 B25	2494	84 192 89>	30-026706-30	63,21	PA 21-26706-20/0	195,94	HBS068
525	256S1	6	>92					
E34 / E36 Vanos Inyección 24 Válvulas						BI 71-3419/6 STD	70,72	(14) M10 x 1.50 x 95
						BA H023/7 STD	110,43	HBS067
								(14) M10 x 1.50 x 110 Para Bloque de Aluminio
325	M50 B25	2494	84 192 92>	30-026706-30	63,21	PA 21-26706-21/0	198,29	HBS068
525	256S2	6						
E34 / E36 Vanos Inyección 24 Válvulas						BI 71-3419/6 STD	70,72	(14) M10 x 1.50 x 95 Para Bloque de HBS067
								(14) M10 x 1.50 x 110 Para Bloque de Aluminio
323	M52 B25	2494	84 170 95>	30-026706-30	63,21	PA 21-26706-22/0	202,28	HBS068
523	256S3	6						
E34 / E36 Vanos Inyección 24 Válvulas						PA 21-26706-23/0	207,97	(14) M10 x 1.50 x 95 Para Bloque de Hierro
						Junta Tapa Válvulas Goma 10 / 1995 >		HBS067
						BI 71-3419/6 STD	70,72	(14) M10 x 1.50 x 110 Para Bloque de Aluminio
325	N52 B25	2497	82 177 05>	30-030334-00	AG9540	PA 02-37289-01	384,19	HBS468
523	N52 B25A	6	218					
525	N52 B25C			30-030337-00	AG9550	BI 77945600	84,39	(1) M9 x 1.25 x 95
Inyección 24 Válvulas						BA 77947600	137,21	(3) M9 x 1.25 x 125 (10) M10 x 1.50 x 125

					
	Nº Cil Ø	Junta culata	PVR	Referencia	PVR

BMW Gasolina

<p>328 M52 B28 2793 84 192 95> 528 286S1 6 728 Z3 Vanos Inyección 24 Válvulas</p>	<p>30-026706-30 Ø 85mm Fibra</p>	<p>63,21</p>	<p>PA 21-26706-22/0 Junta Tapa Válvulas Goma - Metal PA 21-26706-23/0 Junta Tapa Válvulas Goma BI 71-3419/6 STD</p>	<p>202,28 207,97 70,72</p>	<p>HBS068 (14) M10 x 1.50 x 95 Para Bloque de Hierro HBS067 (14) M10 x 1.50 x 110 Para Bloque de Aluminio</p>
<p>328 M52 B28 2793 84 192 98> 528 286S2 728 Z3 Vanos /Inyección 24 Válvulas</p>	<p>30-029100-00 Ø 85mm 0,7mm MLS 30-030053-00 Ø 85mm 1,00mm - MLS + 0,30mm</p>	<p>102,81 205,97</p>	<p>PA 21-29100-20/0 Con Junta Colector normal PA 21-29100-21/0 Con Junta Colector de Pantalla BI 71-3419/6 STD</p>	<p>351,46 416,45 70,72</p>	<p>HBS067 (14) M10 x 1.50 x 110 Para Bloque de Aluminio</p>
<p>330 M54 2979 80 231 00> 530 306S3 6 Z3 X5 E39 Inyección 24 Válvulas</p>	<p>30-029100-00 Ø 85mm Multiáminas 30-030053-00 Ø 85mm Multiáminas + 0,30mm</p>	<p>102,81 205,97</p>	<p>PA 21-29078-21/0 Sin Junta de Culata</p>	<p>319,69</p>	<p>HBS068 (14) M10 x 1.50 x 95 Para Bloque de Hierro HBS067 (14) M10 x 1.50 x 110 Para Bloque de</p>
<p>130 N52 B30 2996 85 258 330 N52 B30A 6 530 N52 B30B 630 730 Inyección / 24 Válvulas</p>	<p>30-030284-00 AG9290 Ø 86mm 1,2 mm - MLS</p>	<p>182,19</p>	<p>PA 02-37289-01 BI 77945600</p>	<p>384,19 84,39</p>	<p>HBS468 (1) M9 x 1.25 x 95 (3) M9 x 1.25 x 125 (10) M10 x 1.50 x 125</p>

					
	Nº Cil Ø	Junta culata	PVR	Referencia	PVR

BMW Gasolina

<p>530 M60 B30 2997 89 218 92> 730 308S1 8 Inyección 32 Válvulas</p>	<p>30-027241-10 49,90 Ø 90mm 1,5mm Izquierda 30-027333-00 CONSULTAR Ø 90mm 1,8mm Izquierda 30-027240-10 59,25 Ø 90mm 1,5mm Derecha 30-027332-00 CONSULTAR Ø 90mm 1,8mm Derecha</p>	<p>PA 21-27249-20/0 320,79 Sin Junta de Culata BI 71-3706/8 STD 98,24</p>	<p>34</p>
<p>M5 M30 B35 3453 93,4 315 88> S38 6 356ED 356EE</p>	<p>30-025069-10 CONSULTAR Ø 94,5mm</p>	<p>PA 21-25069-23/0 373,92</p>	<p>37 HBS071 (14) M12 x 1.75 x 157</p>
<p>540 M60 B44 3982 89 286 91> 740 408S1 8 840 Inyección 32 Válvulas</p>	<p>30-027241-10 49,90 Ø 90mm 1,5mm Izquierda 30-027333-00 CONSULTAR Ø 90mm 1,8mm Izquierda 30-027240-10 59,25 Ø 90mm 1,5mm Derecha 30-027332-00 CONSULTAR Ø 90mm 1,8mm Derecha</p>	<p>PA 21-27249-20/0 320,79 Sin Junta de Culata</p>	<p>38</p>
<p>540 M60 B44 4398 92 286 96> 740 M62 B44 8 840 448S1 Inyección / E38 / E39 32 Válvulas</p>	<p>30-027787-10 CONSULTAR Ø 93mm Izquierda 30-026447-20 CONSULTAR Ø 93mm Derecha</p>	<p>PA 21-27249-21/0 314,33 Sin Junta de Culata BI 71-3706/8 STD 98,24 BA H033/5 STD 176,31</p>	<p>39</p>

Nº Cil Ø

Junta culata

PVR

Referencia

PVR

Tornillos

BMW Diesel

750 M70 B50 4988 84 300 87>
850 12
Inyección

30-026856-00 CONSULTAR
Ø 85mm 1,64mm 1 muesca Izquierda

30-026221-10 CONSULTAR
Ø 85mm 2,13mm 3 muescas Izquierda

30-026857-00 CONSULTAR
Ø 85mm 1,64mm 1 muesca Derecha

30-026223-10 CONSULTAR
Ø 85mm 2,13mm 3 muescas Derecha

PA 21-25983-21/0 CONSULTAR
Sin Junta de Culata

40

DIESEL M47 D20 1995 84 150 02>
118 M47N 4
120 204D4
320
X3
16 Válvulas Inyección Directa
Turbo Diesel Intercooled

30-029236-00 AC5411 94,02
Ø 84,5mm 1,45mm 1 muesca MLS

30-029237-00 AC5421 91,53
Ø 84,5mm 1,55mm 2 muescas MLS

30-029238-00 AC5431 97,20
Ø 84,5mm 1,65mm 3 muescas MLS

PA 21-29236-20/0 CC5410 128,62
Sin Junta de Culata

TQ BFS148SBL R148S 5,29

BI 71-3704/4 STD SPUTTER 10,69

BA H023/5 STD 128,33
SEG 9-0753-00 jgo 4cyl 87,30
148 00

DIAM84 3X2X2

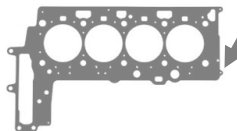
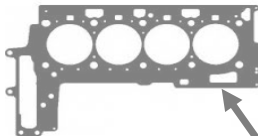
SEG 08-114400-00 53,95

DIAM84 3X2X3

(10) M12 x 1.50 x 146.5

3

DIESEL N47 D20A 1995 84 130 08>
116 - 118 - 120 N47 D20C 4 177
318 - 320 - 520
X1 - X3
16 Válvulas



30-030324-00 AG5010 121,57
Ø 84,5mm 1,46mm 1 muesca MLS

30-030325-00 AG5020 121,57
Ø 84,5mm 1,56mm 2 muescas MLS

30-030326-00 AG5030 121,57
Ø 84,5mm 1,66mm 3 muescas MLS

61-38110-00 127,21
Ø 84,7mm 1,45mm 1 muesca MLS

61-38110-10 127,21
Ø 84,7mm 1,55mm 2 muesca MLS

61-38110-20 127,21
Ø 84,7mm 1,65mm 3 muesca MLS

PA CG5011 186,72
Sin Junta de Culata al otro atm gpa

AL C381 ADM 250,61

AL C382 ESC 250,61

AL C392 ADM

AL C393 ESC

TQ BFS148SBL R974S 5,29

BI 71-4805 STD X4 UNITARIO 9,13

DIAM84 1,75X1,75X2
Diferencia paso

4

Nº Cil Ø

Junta culata

PVR

Referencia

PVR

Tornillos

BMW Diesel

<p>DIESEL M51 D25 2497 80 115 91> 325 256T1 6 143 525 256T1L E34 / E36 TD / TDS</p>	<p>30-027160-40 BW731 123,86 Ø 81mm 1,68mm 2 muescas BW741 BW741 123,86 Ø 81mm 1,87mm 3 muescas</p>	<p>PA 21-27179-20/0 DW730 110,90 Sin Junta de Culata Retén Válvula 7mm / >09 / 92 PA 21-27179-22/0 145,85 Sin Junta de Culata TQ FOL129 14,29</p>	<p>HBS066 (14) M12x1.5x146.5</p>
<p>DIESEL M51 D25 2497 80 143 94> 325 256T1 6 525 256T1L E34 / E36 TD / TDS</p>	<p>30-027395-30 BZ111 119,78 Ø 81mm 1,68mm 2 muescas Fibra 30-027396-20 BZ121 119,78 Ø 81mm 1,87mm 3 muescas Fibra</p>	<p>PA 21-27179-22/0 145,85 Sin Junta de Culata Retén Válvula 6mm 09 / 92 > 01 / 96 PA 21-29320-21/0 156,73 Sin Junta de Culata Retén Válvula 6mm 02 / TQ FOL129 14,29</p>	<p>HBS066 (14) M12x1.5x146.5</p>
<p>DIESEL M57 D25 2497 80 163 00> 525 256D1 6 E39 24 Válvulas Inyección Directa</p>	<p>30-028800-00 84,10 Ø 81mm 1,45mm 1 muesca MLS 30-028801-00 84,10 Ø 81mm 1,55mm 2 muescas MLS 30-028802-00 88,67 Ø 81mm 1,65mm 3 muescas MLS 30-029184-00 CONSULTAR Ø 81mm 1,80mm MLS</p>	<p>PA 21-29149-20/0 DZ660 187,44 Sin Junta de Culata TQ BFS148SBL R148S 5,29 BI 71-3704/6 STD SPUTTER 10,69 BA H023/7 STD 192,47 110,43</p>	<p>HBS066 (14) M12x1.5x146.5</p>

Nº Cil Ø

Junta culata

PVR

Referencia

PVR

Tornillos

BMW Diesel

<p>DIESEL M57 D25TU 2497 84 177 03> 525 256D2 6</p>	<p>30-029111-00 AG9000 97,10 Ø 84,5mm 1,45mm 1 muesca MLS</p> <p>30-029112-00 AG9010 108,62 Ø 84,5mm 1,55mm 2 muescas MLS</p> <p>30-029113-00 AG9020 108,62 Ø 84,5mm 1,65mm 3 muescas MLS</p>	<p>PA 001020024 209,10 Sin Junta de Culata</p> <p>TQ BFS148S 5,29 BL R148S 10,69</p> <p>BI 71-3704/6 STD SPUTTER 192,47</p>	<p>HBS066 (14) M12x1.5x146.5</p>
<p>DIESEL M57 D30 2926 84 193 99> 330 306D1 6 530 730 X5 E38 / E39 / E46 24 Válvulas Inyección Directa</p>	<p>30-028559-10 131,17 Ø 84,5mm 1,45mm 1 muesca MLS</p> <p>30-028560-10 129,70 Ø 84,5mm 1,55mm 2 muescas MLS</p> <p>61-35000-20 121,25 Ø 84,5mm 1,65mm 3 muescas MLS</p> <p>30-029183-00 CONSULTAR Ø 84,5mm 1,80mm MLS</p>	<p>PA 21-29149-20/0 DZ660 187,44 Sin Junta de Culata</p> <p>TQ BFS148SBL R148S 5,29 BI 71-3704/6 STD SPUTTER 10,69 192,47</p> <p>Diam muñequilla 45 BI 71-4805 STD unitario 39,47 Diam muñequilla 50 BA H023/7 STD 110,43 Diam muñequilla 59,98 BA H1238/7 STD 83,26 Diam muñequilla 59,98 CON 1 TALADRO DECENTRADO BA H1298/7 STD 292,85 Diam muñequilla 54,98</p> <p>SEG 08-114400-00 53,95 DIAM84 3X2X3</p>	<p>HBS066 (14) M12x1.5x146.5</p>

Nº Cil Ø

Junta culata

PVR

Referencia

PVR

Tornillos

BMW Diesel

DIESEL 330 525 / 530 / 535 730 X3 / X5 24 Válvulas Inyección Directa	M57 D30	2993	84	270	02								
	306D4		6										
							30-029111-00	AG9000	97,10	PA	02-37402-02	241,94	HBS066
							Ø 84,5mm 1,45mm 1 muesca MLS			TQ	Sin Junta de Culata		
							30-029112-00	AG9010	108,62	BL	BFS148SR148S	5,29	

DIESEL SERIE 3 - 5 - 6 X5 24 Válvulas Inyección Directa	N57N	2993	84	286	07								
	306D5		6										
							Ø 84,5mm 1,47mm 1 muesca MLS						
							30-029113-00	AG9020	108,62	BI	71-3704/6 STD ^{SPUTTER}	10,69	(14) M12x1.5x146.5

						Ø 84,5mm 1,55mm 2 muescas MLS			BA	H023/7 STD	110,43	
						Ø 84,5mm 1,65mm 3 muescas MLS			BA	H1238/7 STD	83,26	

						Ø 84,5mm 1,47mm 1 muesca MLS			PA	02-37402-03	425,50	HBS543
						30-029114-00	AH5920	149,61		SIN JUNTA CULATA		

13

14